

Date : 01/10/2023
Project No : 2022C165
Client Company : Toll Bros. Inc.
Arrival Time : 01/10/2023 08:00
Onsite Hours : 9:00

ASEC Report ID : 56052
Name of the Project : Northfield @ Polo Fields - Phase2
Project Location : Pittman Road, Cumming, GA
Weather : Cloudy
Departure Time : 01/10/2023 17:00
ASEC Technician Name : Vidal Shengan

Our AS Engineering and Consulting (ASEC) representative visited the site at the contractor's request to observe the placement of pipe.

The contractor was observed connecting manhole D1 to manhole D2 with pipe.

The contractor placed additional #57 stone approximately 6" to 8" beneath the pipe as bedding. The pipe was also covered with stone approximately 4 - 6" before starting the first backfill lift.

The contractor is using pumps to keep groundwater out of the work area.


We observed that the contractor did not place fabric prior to installing manhole D2. We recommended they use filter fabric over all stone prior to backfilling with soil. Due to a unsatisfactory weather day, backfilling was not begun. See attached photos.


No fabric below manhole D2

Pipe on up stone 6 to 8"


Pipe in 57 stone

57 stone 6 to 8"

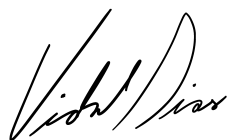

Vidal Dias
070321636
Project Geologist



Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.