


Date : 11/04/2022
Project No : 2022C165
Client Company : Toll Bros. Inc.
Arrival Time : 11/04/2022 12:00
Onsite Hours : 03:00

ASEC Report ID : 55389
Name of the Project : Northfield @ Polo Fields - Phase2
Project Location : Pittman Road, Cumming, GA
Weather : Sunny
Departure Time : 11/04/2022 15:00
ASEC Technician Name : Vidal Dias

Test Date	Test Number	Moisture Content (%)	Dry Density (pcf)	Proctor Number	Max. Dry Density (pcf)	Optimum Moisture (%)	Compaction (%)	Specified Compaction (%)	ASTM Test Method	Pass/Fail
11/04/2022	1	19.8	119.7	1	83.2	25.3	120.1	95	D6938	Pass
Location : , Elv/Depth :1187										
Comment : Different material from the Moisture-Density Relationship on file. Sample retrieved to run new proctor.										
Tested By : Vidal Dias Gauge Serial No. :										

Remark: Test performed in general accordance with signed referenced ASTM Method.

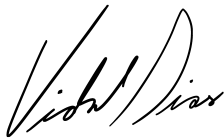

Vidal Dias
070321636
Project Geologist



Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.

Date : 11/04/2022
Project No : 2022C165
Client Company : Toll Bros. Inc.
Arrival Time : 11/04/2022 12:00
Onsite Hours : 03:00

ASEC Report ID : 55389
Name of the Project : Northfield @ Polo Fields - Phase2
Project Location : Pittman Road, Cumming, GA
Weather : Sunny
Departure Time : 11/04/2022 15:00
ASEC Technician Name : Vidal Dias

PROCTOR DATA SUMMARY

TEST DATE	PROCTOR ID	MAX DRY DENSITY (pcf)	OPTIMUM MOISTURE (%)	PROCTOR TYPE	SOIL DESCRIPTION
10/25/2022	1	83.2	25.3	Standard	Reddish Brown Sandy CLAY
10/25/2022	2	95.0	23.5	Standard	Tan Sandy CLAY
10/25/2022	3	99.4	21.3	Standard	Reddish Brown Sandy CLAY
03/21/2023	4	98.6	20.2	Standard	Reddish Brown Silty SAND w/ trace of Clay
03/21/2023	5	93.8	20.9	Standard	Brown Sandy SILT w/ PWR Fragments