

Date : 07/24/2023  
Project No : 2022C165  
Client Company : Toll Bros. Inc.  
Arrival Time : 07/24/2023 08:00  
Onsite Hours : 08:00

ASEC Report ID : 60457  
Name of the Project : Northfield @ Polo Fields - Phase2  
Project Location : Pittman Road, Cumming, GA  
Weather : Partly Cloudy  
Departure Time : 07/24/2023 16:00  
ASEC Technician Name : Vidal Dias

Our ASEC representative arrived on site to perform a site inspection at the designated work area, located at the entrance of the Northfields neighborhood. The exact location is highlighted in Attachment A.

In accordance with the verbal instructions of Forsyth County inspectors and DOT guidelines, Wilbanks contractors executed excavation operations to a depth of 17 inches. At this depth, the presence of wet soils was noted in Areas A & B (see Attachment B).


In response to these conditions, ASEC issued a recommendation for an additional 5-inch excavation in Areas A & B to remove the saturated soils. Wilbanks contractors proceeded with the advised measure, backfilling the area with #34 stone.

Subsequent to backfilling, compaction was conducted using a vibratory roller. Eight passes were performed over the area. A 10-inch layer of GAB was installed atop the stone to fortify the area further.



Date : 07/24/2023  
Project No : 2022C165  
Client Company : Toll Bros. Inc.  
Arrival Time : 07/24/2023 08:00  
Onsite Hours : 08:00

ASEC Report ID : 60457  
Name of the Project : Northfield @ Polo Fields - Phase2  
Project Location : Pittman Road, Cumming, GA  
Weather : Partly Cloudy  
Departure Time : 07/24/2023 16:00  
ASEC Technician Name : Vidal Dias

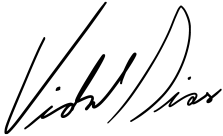

**Vidal Dias**  
**070321636**  
**Project Geologist**



**Kenneth Mosman**

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.