

Date : 02/15/2023
Project No : 2022C190
Client Company : DRH
Arrival Time : 02/15/2023 10:10
Onsite Hours : 05:45

ASEC Report ID : 57207
Name of the Project : Lakes at Statham
Project Location : Barrow County
Weather :
Departure Time : 02/15/2023 16:00
ASEC Technician Name : Russell Hendrix

Our AS ENGINEERING AND CONSULTING, LLC representative visited the site at the client's request to perform DCP testing on Lots #72, 73, 74, 75, and 76. Unconsolidated soft soils were encountered in the top 12 inches in Lots #74B, 76A, and 73C.

Water was encountered between three and four feet in Lots #72, 75, and 76.

DCP data and drawings are attached:

Lot 72A-South Side

- 1- 13 Brown, Sandy SILT.
- 2- AR

Lot 72 Offset

- 1- 13- Brown, Sandy, SILT.
- 2- 7- Brown, Sandy, SILT.
- 3- 10- Gray, Sandy, CLAY.
- 4- 8- Gray, Sandy, CLAY.

Lot 73C-North Side

- 1- 1- Brown, Sandy SILT.
- 2- 3- Brown, Sandy SILT.
- 3- 6- Red, brown, Sandy SILT.
- 4- 18- Purple, brown, Sandy SILT.

Lot 73B- Middle Side

- 1- AR

Lot 73 Offset

- 1- 6- Brown, Sandy CLAY.
- 2- 10- Brown, Sandy CLAY.
- 3- 12- Brown, Sandy SILT.
- 4- 16- Brown, Sandy SILT.

Lot 74A-North Side

- 1- 7- Gray, Sandy CLAY.
- 2- 10- Brown, Sandy CLAY.
- 3- 8- Brown, micaceous, Sandy SILT.
- 4- 17- Brown, micaceous, Sandy SILT.

Lot 74B-South Side

- 1- 3- Brown, micaceous, Sandy SILT.
- 2- 14- Red, brown, micaceous, Sandy SILT.
- 3- 9- White, brown, micaceous, Sandy SILT.

Date : 02/15/2023
Project No : 2022C190
Client Company : DRH
Arrival Time : 02/15/2023 10:10
Onsite Hours : 05:45

ASEC Report ID : 57207
Name of the Project : Lakes at Statham
Project Location : Barrow County
Weather :
Departure Time : 02/15/2023 16:00
ASEC Technician Name : Russell Hendrix

4- 20- White, micaceous, Sandy SILT.

Lot 75A-North Side Nearest road

- 1- 13- Brown, micaceous, Sandy SILT.
- 2- 20- Brown, micaceous, Sandy SILT.
- 3- 20- Brown, micaceous, Sandy SILT.
- 4- 20- Brown, micaceous, Sandy SILT.

Lot 75B

- 1- 8- Gray, Sandy CLAY.
- 2- 12- Brown, Sandy CLAY.
- 3- 13- Brown, micaceous, Sandy SILT.
- 4- 15- Brown, micaceous, Sandy SILT.

Lot 76A-South Side

- 1- 8- Gray, Sandy CLAY.
- 2- 6- Gray, Sandy CLAY.
- 3- 6- Gray, Sandy CLAY.
- 4- 8- Gray, Sandy CLAY.

Lot 76B

- 1- AR

Lot 76C-North Side Nearest Road

- 1- 2- Red, Sandy SILT.
- 2- 3- Red, Sandy SILT.
- 3- 5- Gray, Sandy CLAY.
- 4- 5- Brownish red, CLAY.

Date : 02/15/2023
Project No : 2022C190
Client Company : DRH
Arrival Time : 02/15/2023 10:10
Onsite Hours : 05:45

ASEC Report ID : 57207
Name of the Project : Lakes at Statham
Project Location : Barrow County
Weather :
Departure Time : 02/15/2023 16:00
ASEC Technician Name : Russell Hendrix



Lot 72



Lot 73



Lot 74




Lot 75

Date : 02/15/2023
Project No : 2022C190
Client Company : DRH
Arrival Time : 02/15/2023 10:10
Onsite Hours : 05:45


ASEC Report ID : 57207
Name of the Project : Lakes at Statham
Project Location : Barrow County
Weather :
Departure Time : 02/15/2023 16:00
ASEC Technician Name : Russell Hendrix



Lot 76

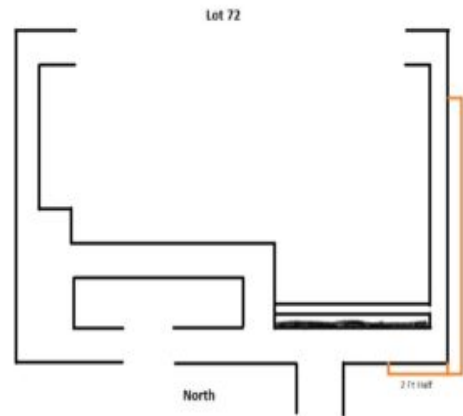

Lot 72 Drawing

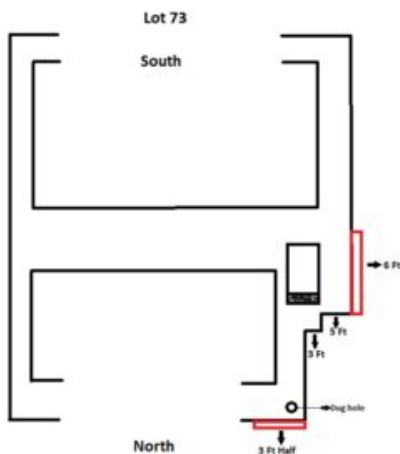

Lot 73 Drawing

Vidal Dias

Vidal Dias
070321636
Project Geologist

Kenneth Mosman

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.