


Date : 03/13/2023
Project No : 2022C235
Client Company : Jackson Demolition Service, Inc.
Arrival Time : 03/13/2023 06:00
Onsite Hours : 10:30

ASEC Report ID : 57680
Name of the Project : Plant Gorgas Demolition and Grading
Project Location : 460 Gorgas Rd, Parrish, AL 35580
Weather : Sunny
Departure Time : 03/13/2023 16:30
ASEC Technician Name : Vidal Dias

Test Date	Test Number	Moisture Content (%)	Dry Density (pcf)	Proctor Number	Max. Dry Density (pcf)	Optimum Moisture (%)	Compaction (%)	Specified Compaction (%)	ASTM Test Method	Pass/Fail
03/13/2023	1	5	140.0	44789	131.9	9.5	101.1		D6938	Pass
Location : C6, Elv/Depth :277										
Comment :										
Tested By :				Vidal Dias			Gauge Serial No. :			
03/13/2023	Test 2	3.1	145.1	44789	131.9	9.5	106.7		D6938	Pass
Location : B6, Elv/Depth :276										
Comment :										
Tested By :				Vidal Dias			Gauge Serial No. :			
03/13/2023	Test 3	3.2	152.5	44789	131.9	9.5	115.6		D6938	Pass
Location : H6 near the boundary of G6, Elv/Depth :276										
Comment :										
Tested By :				Vidal Dias			Gauge Serial No. :			
03/13/2023	Test 4	4	148.5	44789	131.9	9.5	108.3		D6938	Pass
Location : F6, Elv/Depth :276										
Comment :										
Tested By :				Vidal Dias			Gauge Serial No. :			

Remark: Test performed in general accordance with signed referenced ASTM Method.

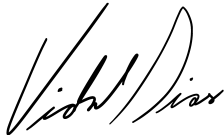

Vidal Dias
070321636
Project Geologist



Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.

Date : 03/13/2023
Project No : 2022C235
Client Company : Jackson Demolition Service, Inc.
Arrival Time : 03/13/2023 06:00
Onsite Hours : 10:30

ASEC Report ID : 57680
Name of the Project : Plant Gorgas Demolition and Grading
Project Location : 460 Gorgas Rd, Parrish, AL 35580
Weather : Sunny
Departure Time : 03/13/2023 16:30
ASEC Technician Name : Vidal Dias

PROCTOR DATA SUMMARY

TEST DATE	PROCTOR ID	MAX DRY DENSITY (pcf)	OPTIMUM MOISTURE (%)	PROCTOR TYPE	SOIL DESCRIPTION
10/04/2022	43408	97.0	24.4	Standard	Yellowish Brown Fat CLAY with Sand.
10/04/2022	43409	107.5	17.8	Standard	Reddish brown Clayey SAND
10/04/2022	43410	104.3	20.2	Standard	Olive brown Sandy Lean Clay
10/04/2022	43412	103.5	22.0	Standard	Brown Sandy Lean CLAY
10/04/2022	43413	104.0	19.7	Standard	Olive brown Lean CLAY with Sand
02/15/2023	44789	131.9	9.5	Standard	825B / 8910