

Date : 05/03/2023
Project No : 2022C235
Client Company : Jackson Demolition Service, Inc.
Arrival Time : 05/03/2023 06:00
Onsite Hours : 10:30

ASEC Report ID : 59029
Name of the Project : Plant Gorgas Demolition and Grading
Project Location : 460 Gorgas Rd, Parrish, AL 35580
Weather : SUNNY
Departure Time : 05/03/2023 16:30
ASEC Technician Name : Avinash Bandham

AS ENGINEERING AND CONSULTING, LLC (ASEC) representative Avinash Bandam visited the site at the request of Jackson Demolition representative Josh Kelly. The undersigned representative was present to monitor, verify and document the ongoing project activities. (Reference drawing E720661 S1 - R5, E720659 S1-R5.)

During the visit, the following observations were made:

1. Two thousand four hundred and eighty four (2484) cubic yards of fill materials were placed for lift (10) in section 1 area B7 (drawing E720661) of the basement. The materials were placed and compacted in accordance with ITP-001.
2. The area was probed, and one moisture density test was performed in section 1 area B7 (E720661 S1 - R5), test-1 is positioned at the center of the section-1. Test-2 and test-3 were performed in section-2 area G7 which are positioned near to the east and west walls. The test locations are shown here in the attached drawing (E720659 S1-R5, E720661 S1 - R5).
3. The one-point proctor test was performed to verify the appropriate Proctor curve for these tests.
4. Drive cylinder tube test was performed in section-2 of the basement area G7 in the vicinity of Test 4 performed on this day.



compaction using the roller in section-2 south end wall side.

Date : 05/03/2023
Project No : 2022C235
Client Company : Jackson Demolition Service, Inc.
Arrival Time : 05/03/2023 06:00
Onsite Hours : 10:30



ASEC Report ID : 59029
Name of the Project : Plant Gorgas Demolition and Grading
Project Location : 460 Gorgas Rd, Parrish, AL 35580
Weather : SUNNY
Departure Time : 05/03/2023 16:30
ASEC Technician Name : Avinash Bandham



Placement of lift-10 in section-1 basement area B7.




Loads received in the basement

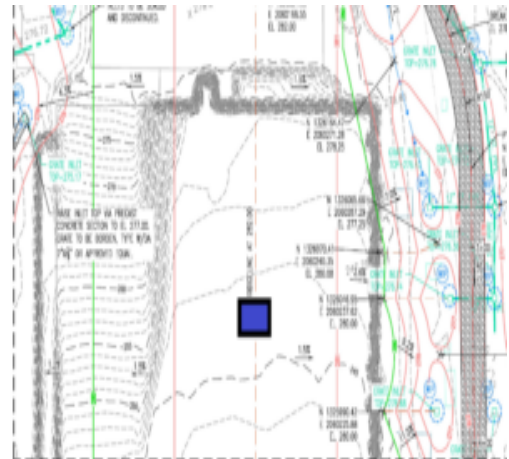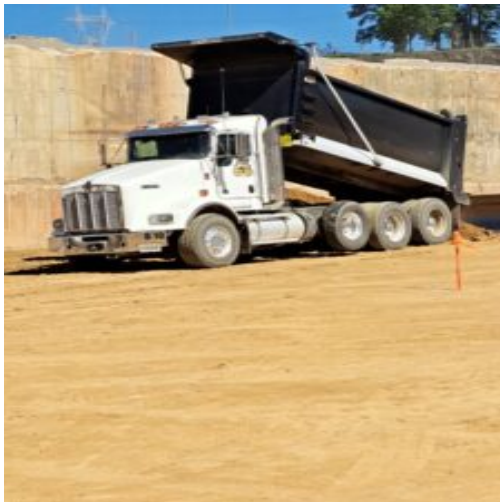

Showing Test-1 Location in section-1 basement area B7

Date : 05/03/2023
Project No : 2022C235
Client Company : Jackson Demolition Service, Inc.
Arrival Time : 05/03/2023 06:00
Onsite Hours : 10:30

ASEC Report ID : 59029
Name of the Project : Plant Gorgas Demolition and Grading
Project Location : 460 Gorgas Rd, Parrish, AL 35580
Weather : SUNNY
Departure Time : 05/03/2023 16:30
ASEC Technician Name : Avinash Bandham

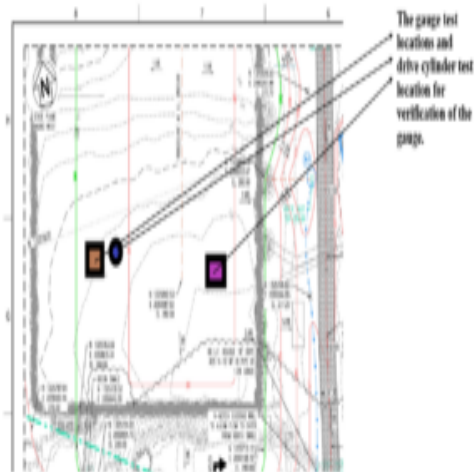

Showing Tes-2 and Test-3 locations along with drive cylinder test in section-2 basement area G7.



Ramchandra Mogulla, PE
31220
Senior Engineer

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.