

Date : 04/23/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/23/2026
Onsite Hours : N/A

ASEC Report ID : 93679
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAlA, Atlanta, GA
Weather : overcast
Departure Time : 04/23/2026
ASEC Technician Name : Russell Hendrix

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day:

Area 1

A proof roll was conducted for one lane on the west side using a loaded tandem dump truck. Representatives from AtlNext, CW Matthews, and 2MNext were present and unanimously agreed that the subgrade conditions were acceptable. No remediation was required.

Area 2

Backfill was placed in approximately 12-inch lifts and compacted using a ride-on vibratory sheepsfoot roller (CP56B). Compaction testing was performed using a Troxler 3430 (Serial No. 38069). Refer to the testing report for detailed results.

Area 3

Excavation activities commenced and progressed to an approximate depth of 10 feet.

Area 4

Backfill consisting of No. 89 stone was placed along with installation of 4-inch sleeved corrugated pipe. A surveyor was present onsite to verify slope for proper drainage.

Area 5

Final lift compaction was completed using a trench packer. Density testing was performed using a Troxler 3430. Refer to the testing report for results.

Area 6

Excavation operations began using a Caterpillar 336 excavator.

Runway

A total of 14 locations had been previously cored around light cans. A concrete pour commenced at approximately 3:15 PM on this date. Refer to the concrete testing report for additional details.

No further observations were made on this day.

Date : 04/23/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/23/2026
Onsite Hours : N/A

ASEC Report ID : 93679
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAlA, Atlanta, GA
Weather : overcast
Departure Time : 04/23/2026
ASEC Technician Name : Russell Hendrix



proof roll



Placing concrete around light cans center runway.



compacting lift



proof roll (2nd angle)

Date : 04/23/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/23/2026
Onsite Hours : N/A

ASEC Report ID : 93679
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAlA, Atlanta, GA
Weather : overcast
Departure Time : 04/23/2026
ASEC Technician Name : Russell Hendrix



compacting final lift



compacting final lift



light cans cored before concrete placement



excavation

Date : 04/23/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/23/2026
Onsite Hours : N/A


ASEC Report ID : 93679
Name of the Project : Airfield Repairs 2021-23
Project Location : HJATA, Atlanta, GA
Weather : overcast
Departure Time : 04/23/2026
ASEC Technician Name : Russell Hendrix



89 stone placement



Excavation

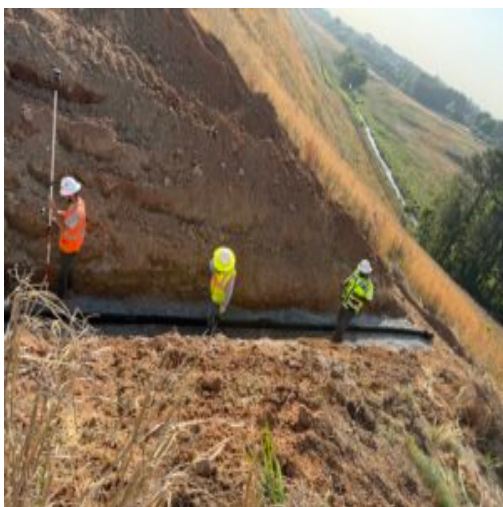

Pipe placement and surveyor verification



Pipe placement

Date : 04/23/2026
Project No : 2023C159
Client Company : CW Matthews
Arrival Time : 04/23/2026
Onsite Hours : N/A

ASEC Report ID : 93679
Name of the Project : Airfield Repairs 2021-23
Project Location : HJAlA, Atlanta, GA
Weather : overcast
Departure Time : 04/23/2026
ASEC Technician Name : Russell Hendrix



excavation



Area 5 final lift

Kenneth Mosman

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.