

Date : 07/09/2026
Project No : 2026C100
Client Company : Artisan
Arrival Time : 07/09/2026 12:00
Onsite Hours : 03:00

ASEC Report ID : 96072
Name of the Project : Naturewalk PHASE 3 (PH 2 Extension)
Lots
Project Location : Dallas
Weather : sunny
Departure Time : 07/09/2026 15:00
ASEC Technician Name : Samara Simha Reddy Kandi

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.

At the future lot areas, fill material was delivered using articulated dump trucks, spread and leveled with a crawler bulldozer, and compacted using a sheepsfoot roller. I observed the fill placement and compaction activities and performed in-place density testing at selected locations within the compacted fill. The initial density test results did not meet the required project compaction criteria at the locations tested. The contractor was informed of the failing results, and it was recommended that the affected areas be scarified, reworked, and re-compacted prior to retesting.




The crew began reworking the affected fill and performed additional rolling using loaded trucks and a sheepfoot roller. Before follow-up density testing could be performed, rainfall began at the site.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.



Date : 07/09/2026
Project No : 2026C100
Client Company : Artisan
Arrival Time : 07/09/2026 12:00
Onsite Hours : 03:00

ASEC Report ID : 96072
Name of the Project : Naturewalk PHASE 3 (PH 2 Extension)
Lots
Project Location : Dallas
Weather : sunny
Departure Time : 07/09/2026 15:00
ASEC Technician Name : Samara Simha Reddy Kandi

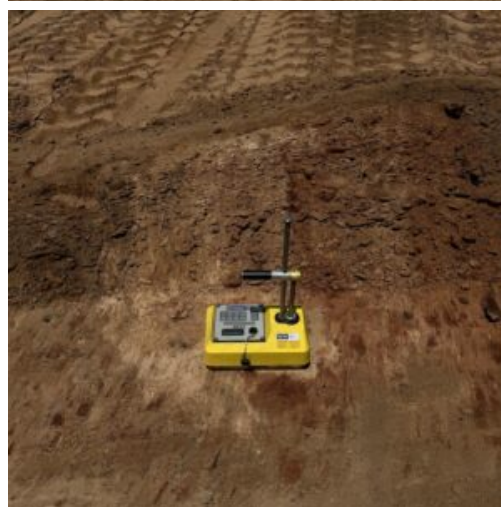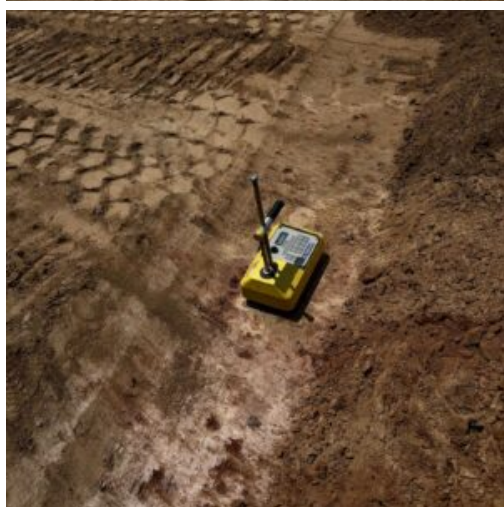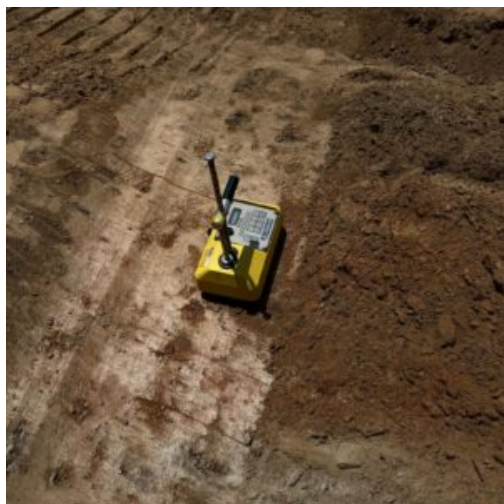

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.