

Date : 07/20/2026
Project No : 2025C214
Client Company : Artisan
Arrival Time : 07/20/2026 06:30
Onsite Hours : 05:30


ASEC Report ID : 96312
Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
Project Location : Dallas
Weather : Sunny
Departure Time : 07/20/2026 12:00
ASEC Technician Name : Clyde Smith

On the above date the writer was on site as requested and assisted in monitoring and testing concrete pour for bridge slab deck pour of 135 yards. The writer assisted in molding three sets (6) 4x8 cylinders, see additional report dated today by ASEC technician.

The writer reobserved placement of reinforcing steel at bridge panels prior to concrete pour. Discrepancies observed on 7/17/26 were corrected.

The writer also observed proof rolling of remaining damaged sub grade to sanitary sewer manhole #12 using a loaded tandem dump truck having 18 plus tons. The sub grade was also observed by members from NWGP who begin repair measures clipping damaged sub grade to replace with additional base stone. The contractor clipped out a section today recommended for 4" placing six loads of base stone with contract base stone included.

The writer also observed the Grading contractor hammering residual rock at building lots.

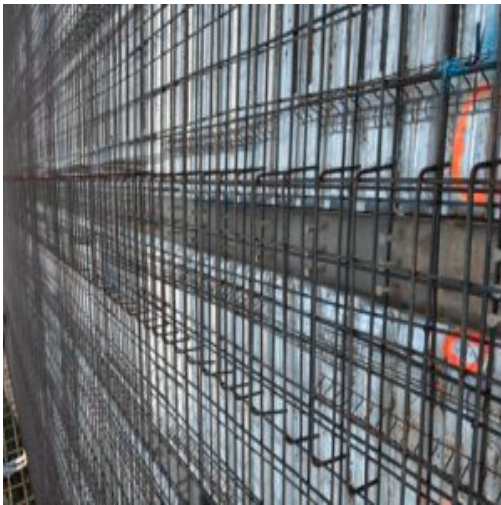

Reinforcing steel in place at panels deck



Date : 07/20/2026
Project No : 2025C214
Client Company : Artisan
Arrival Time : 07/20/2026 06:30
Onsite Hours : 05:30

ASEC Report ID : 96312
Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
Project Location : Dallas
Weather : Sunny
Departure Time : 07/20/2026 12:00
ASEC Technician Name : Clyde Smith




Resteel observations panel decks were cleaned



Sampling of placed concrete



Concrete placement at sidewalk

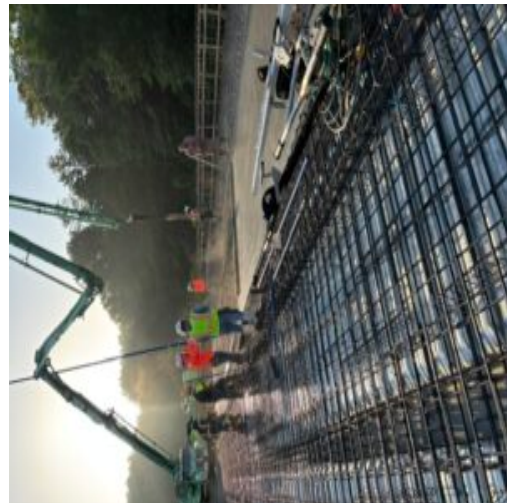

Concrete placement by pumping

Date : 07/20/2026
Project No : 2025C214
Client Company : Artisan
Arrival Time : 07/20/2026 06:30
Onsite Hours : 05:30



ASEC Report ID : 96312
Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
Project Location : Dallas
Weather : Sunny
Departure Time : 07/20/2026 12:00
ASEC Technician Name : Clyde Smith



#6 vertical bars in place at support dowel rods manhole # 12 which clipping was recommended to repair from rain events and construction traffic




Observing proof of remaining subgrade to sanitary sewer

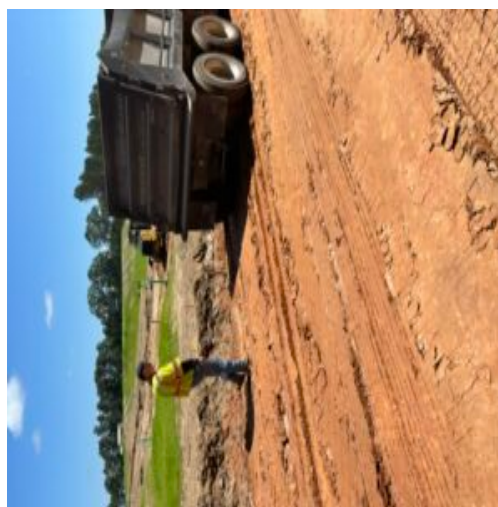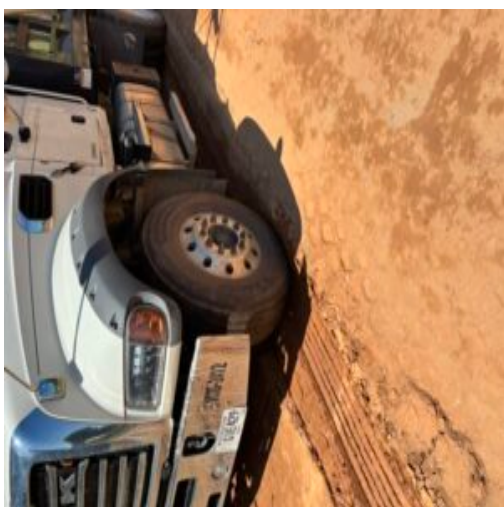

Date : 07/20/2026
Project No : 2025C214
Client Company : Artisan
Arrival Time : 07/20/2026 06:30
Onsite Hours : 05:30

ASEC Report ID : 96312
Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
Project Location : Dallas
Weather : Sunny
Departure Time : 07/20/2026 12:00
ASEC Technician Name : Clyde Smith

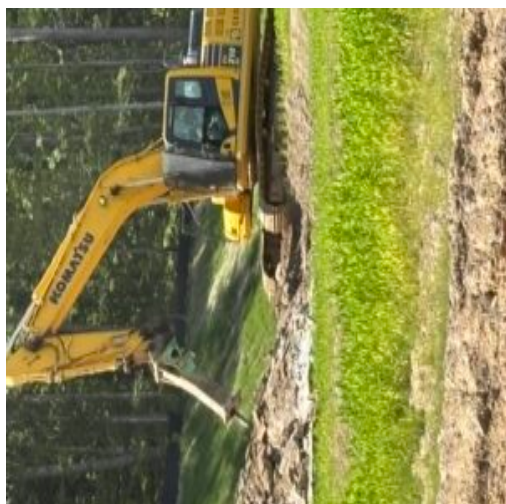

Hammering of residual rock at bldg lot

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.