

Date : 08/11/2026
Project No : 2025C214
Client Company : Artisan
Arrival Time : 08/11/2026 11:30
Onsite Hours : 06:30

ASEC Report ID : 96813
Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
Project Location : Dallas
Weather : cloudy
Departure Time : 08/11/2026 18:00
ASEC Technician Name : Clyde Smith

As requested, the site was visited by our AS Engineering and Consulting (ASEC) representative for the purpose of providing quality control inspection and testing services. Visual observation techniques were employed to verify compliance with project drawing/specifications, applicable codes, and materials submittals. The following observations were observed on site this day.

On the above date our representative was onsite to observe the wall contractor RWS continue backfilling at the bridge abutment west side after retests were performed at failed locations. Retests were in compliance with project specifications. The writer continued observing fill placement and performing density tests using a Troxler Nuclear gauge model 3430, serial no. 91643.

The writer observed the curb contractor continue pouring approximately 300 lineal feet of 30" curb at Naturewalk parkway using a 3000-psi concrete mix,


The grading contractor Thompson continued placing fill at Unit 4 Phase 3 future Lots #66, 67 and 68. The contractor has placed approximately six feet of fill at rear of lots. It is recommended to perform DCP tests at these fill locations to verify compaction efforts.

The writer also observed the pipe contractor Savannah continue installing 20" and 16" casing for 12" and 10" ductile iron water line at the bridge roundabout.

We appreciate the opportunity to be of service to you on this project. If you have any questions regarding this report, please feel free to contact us. We will be more than happy to discuss it with you.




Fill placement and density testing at west side bridge abutment

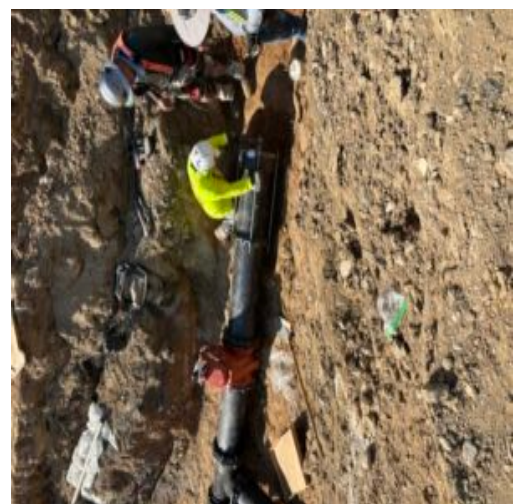


Installation of water line at round about

Date : 08/11/2026
Project No : 2025C214
Client Company : Artisan
Arrival Time : 08/11/2026 11:30
Onsite Hours : 06:30

ASEC Report ID : 96813
Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
Project Location : Dallas
Weather : cloudy
Departure Time : 08/11/2026 18:00
ASEC Technician Name : Clyde Smith

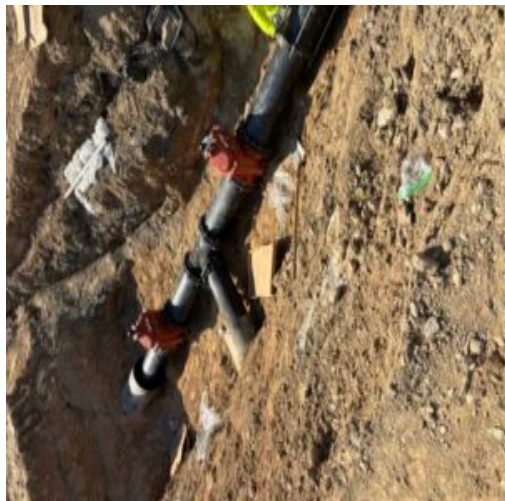

Density tests performed at bridge abutment west side

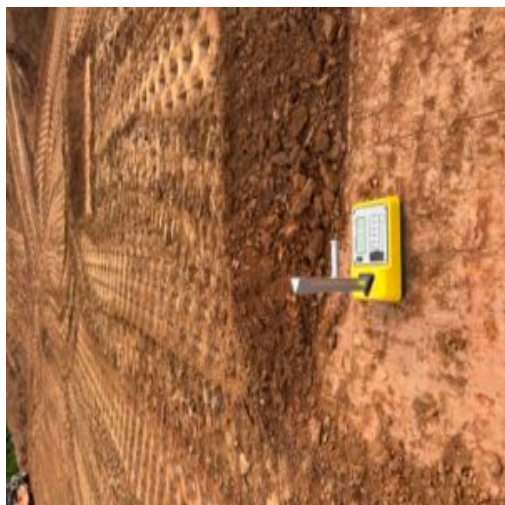


Date : 08/11/2026
Project No : 2025C214
Client Company : Artisan
Arrival Time : 08/11/2026 11:30
Onsite Hours : 06:30

ASEC Report ID : 96813
Name of the Project : NW Unit 4 BRIDGE (Materials Testing)
Project Location : Dallas
Weather : cloudy
Departure Time : 08/11/2026 18:00
ASEC Technician Name : Clyde Smith



Fill placement and compacting efforts at bridge abutment

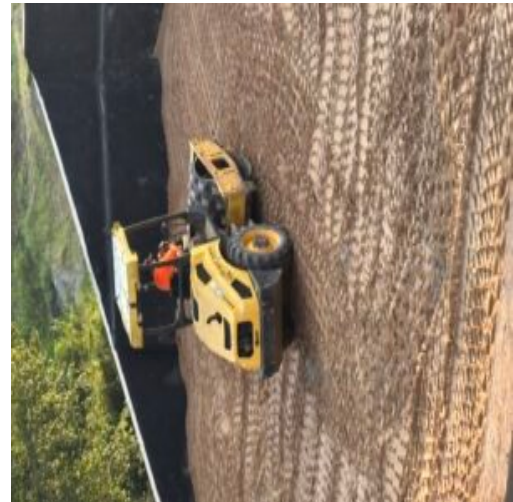

Kenneth Mosman

Kenneth Mosman

The results presented in this report relate only to the items tested. This report shall not be reproduced, except in full, without written approval from AS Engineering and Consulting LLC.